HIGHWAY BRIDGE SCOUR PLAN OF ACTION REPORT



COUNTY: CARROLL

BRIDGE ID NUMBER: 09008140001 BRIDGE OWNER: CARROLL COUNTY ROAD NAME: WESTPORT RD CROSSING: BEAVER CREEK

LATITUDE" N 35 93908 DEGREES

ROUTE: 00814 SPECIAL CASE: 0 COUNTY SEQUENCE: 1 LOG MILE: 2.02

LON	NGITUDE: W 88.37753 DEGREES	YEAR BUILT: 1960	
		TYPE OF SUPERSTRUCTURE	
MAIN SPAN:	PRESTRESSED CONCRETE - BOX GIRDERS - MULTIPLE		
		TYPE OF SUBSTRUCTURE	
ABUTMENTS:	TIMBER CAP ON TIMBER PILE FOL	INDATION	
BENTS:	NOT APPLICABLE		
PIERS:	NOT APPLICABLE		
		SCOUR EVALUATION	
	our critical; bridge foundations de ling scour countermeasures.	etermined to be unstable for calculated scour conditions. Monitor bridge in	
		INSPECTION PROCEDURES	
What Initiat	ed the Call-out Inspection?	[] BridgeWatch Alert	
	-	[] TDOT District or Local Maintenance Personnel	
		[] THP or Local Law Enforcement Personnel	
		[] Other:	
1. C 2. C [] - Chec [] - Chec	Check for plumb of piers or be k for embankment erosion k for drift build-up on piers or k pier exposure, if possible, a	n along curb line, both bridge rails and outer edge of bridge deck. nts.	
[] - Stay a Coun temp	nty or City Maintenance Person	cross road until bridge is secured and properly closed by District, nnel. Use Barricade Tape, traffic cones and/or traffic flares as rists to stay off of the bridge until such time as the bridge may	
-	• •	Supervisor (if bridge is State maintained)	
[] - Conta	` '	y Maintenance Official (if bridge is not State maintained)	
	` ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' '	atrol and/or local law enforcement Officers as appropriate	
	(4) TDOT Regional Bridge	• • •	
	The Bridge should remain closed until the water recedes and a daylight visual inspection is made by a TDOT bridge inspection team.		

PUBLICATION DATE

HIGHWAY BRIDGE SCOUR PLAN OF ACTION REPORT



officials in es		State District maintenance or local highway maintenance bridge on the selected detour route shall be checked	
	he bridge can be re-opened only after a TDOT bridge inspection team checks the substructure nits and they are determined to be structurally stable.		
CONTACT PERS	SONNEL:	TELEPHONE NUMBER:	
COUNTY MAYO	R'S OFFICE	(731) 986-1936	
HWY. CHIEF AD	MINISTRATOR'S OFFICE	(731) 986-1998	
COUNTY SHERI	FF'S OFFICE	(731) 986-8947	
The report sh as appropriat	all include the date and time of e, photographs of the bridge a	spection to BridgeWatch scour monitoring system. If the inspection, a brief summary of findings and, If significant If be copied to Bridge Inspection Headquarters.	
Suggested List of E	Equipment to conduct the Inspe	ection:	
Latest Bridge Inspe	ection Report		
•	with the above Checklist		
Bridge Design Plan	•		
Tape measure with	weight		
Plumb bob			
Range Pole			
A 1000 Foot Roll of		Tape printed with the following message:	
	SAFETY HAZARD KE	EP AWAY	

TDOT radio directory (State Personnel only)

Traffic Cones - Minimum of four (4)

A Barricade Tape Dispenser with serrated cutter

Traffic Safety Flares - Minimum of four (4) or set of electronic warning flashers

TDOT two-way radio (State Personnel only) and/or cellular telephone

A roll of Duct Tape