HIGHWAY BRIDGE SCOUR PLAN OF ACTION REPORT



BRIDGE ID NUMBER: 360A4980001
BRIDGE OWNER: HARDIN COUNTY
ROAD NAME: HANLEY LN
CROSSING: ROGERS CREEK

LATITUDE:: N 35.14308 DEGREES
LONGITUDE: W 88.06892 DEGREES

COUNTY: HARDIN
ROUTE: 0A498
SPECIAL CASE: 0
COUNTY SEQUENCE: 1
LOG MILE: 0.05
YEAR BUILT: 1968

LON	NGITUDE: W 88.06892 DEGREES		YEAR BUILT: 1968
MAIN SPAN:	STEEL - STRINGER/MULTI-BEAM OR	TYPE OF SUPERSTRUCTURE = GIRDER APPR. SPAN:	NOT APPLICABLE
		TYPE OF SUBSTRUCTURE =	
ABUTMENTS:	TIMBER CAP ON TIMBER PILE FOUN		
BENTS:	NOT APPLICABLE		
PIERS:	NOT APPLICABLE		
		OCCUP TVALUATION	
5		SCOUR EVALUATION =	
	our critical; bridge foundations det ling scour countermeasures.	ermined to be unstable for cal	lculated scour conditions. Monitor bridge in
		INSPECTION PROCEDURES =	
What Initiated the Call-out Inspection?		[] BridgeWatch Alert	
		[] TDOT District or Loca	al Maintenance Personnel
		[] THP or Local Law En	forcement Personnel
		[] Other:	
Things to c	heck on a bridge during floods	<u> </u>	
[] - Span	movement - horizontally as we	ll as vertically	
1. C	Check displacement / deflection	along curb line, both bridg	e rails and outer edge of bridge deck.
	Check for plumb of piers or ben	ts.	
	k for embankment erosion		
	k for drift build-up on piers or k		
	k pier exposure, if possible, and	• •	
[] - Revie	ew the latest bridge inspection	report versus current field c	onditions
If Closure is	recommended:		
Coun temp	nty or City Maintenance Personi	nel. Use Barricade Tape, traf	cured and properly closed by District, ffic cones and/or traffic flares as until such time as the bridge may
-	act: (1) District Maintenance Su	pervisor (if bridge is State	maintained)
	• •	, , ,	ridge is not State maintained)
		•	ement Officers as appropriate
	(4) TDOT Regional Bridge		
	- The Bridge should remain closed until the water recedes and a daylight visual inspection is made by a TDOT bridge inspection team.		

PUBLICATION DATE

HIGHWAY BRIDGE SCOUR PLAN OF ACTION REPORT



offic	•	te District maintenance or local highway maintenance idge on the selected detour route shall be checked	
	he bridge can be re-opened only after a TDOT bridge inspection team checks the substructure nits and they are determined to be structurally stable.		
CON	TACT PERSONNEL:	TELEPHONE NUMBER:	
cou	NTY MAYOR'S OFFICE	(731) 925-9078	
HWY	CHIEF ADMINISTRATOR'S OFFICE	(731) 925-4993	
cou	NTY SHERIFF'S OFFICE	(731) 925-3377	
The as a	report shall include the date and time of the propriate, photographs of the bridge and	ection to BridgeWatch scour monitoring system. ne inspection, a brief summary of findings and, stream channel measurements. If significant e copied to Bridge Inspection Headquarters.	
COMMENTS	S:		
Suggested	d List of Equipment to conduct the Inspect	ion:	
Latest Brid	dge Inspection Report		
Scour PO	A Report with the above Checklist		
•	sign Plans, if available		
•	sure with weight		
Plumb bol			
Range Pol			
A 1000 Fo	ot Roll of yellow Polyethylene Barricade Ta		
	SAFETY HAZARD KEEP	AWAY	

TDOT radio directory (State Personnel only)

Traffic Cones - Minimum of four (4)

A Barricade Tape Dispenser with serrated cutter

Traffic Safety Flares - Minimum of four (4) or set of electronic warning flashers

TDOT two-way radio (State Personnel only) and/or cellular telephone

A roll of Duct Tape