HIGHWAY BRIDGE SCOUR PLAN OF ACTION REPORT



BRIDGE ID NUMBER: 390A1020001

BRIDGE OWNER: HENDERSON COUNTY

ROAD NAME: **STANFILL RD**CROSSING: **OLIVE BRANCH**

COUNTY: HENDERSON
ROUTE: 0A102
SPECIAL CASE: 0
COUNTY SEQUENCE: 1
LOG MILE: 1.07

	TITUDE:: N 35.71467 DEGREES IGITUDE: W 88.36369 DEGREES	
		TYPE OF SUPERSTRUCTURE
MAIN SPAN:	WOOD OR TIMBER - STRINGER/MU GIRDER	
		TYPE OF SUBSTRUCTURE
	TIMBER CAP ON TIMBER PILE FOU	
BENTS:	TIMBER PILE BENT ON PILE FOUN	DATION
PIERS:	NOT APPLICABLE	
		SCOUR EVALUATION
	our critical; bridge foundations de ing scour countermeasures.	etermined to be unstable for calculated scour conditions. Monitor bridge in
		INSPECTION PROCEDURES
What Initiated the Call-out Inspection?		[] BridgeWatch Alert
		[] TDOT District or Local Maintenance Personnel
		[] THP or Local Law Enforcement Personnel
		[] Other:
[] - Span	heck on a bridge during flood movement - horizontally as w	ell as vertically
	•	n along curb line, both bridge rails and outer edge of bridge deck.
	Check for plumb of piers or be	nts.
• •	k for embankment erosion	
	k for drift build-up on piers or	
		nd compare to previous inspection
[] - Revie	ew the latest bridge inspection	report versus current field conditions
If Closure is	recommended:	
Coun temp	ty or City Maintenance Persor	cross road until bridge is secured and properly closed by District, nnel. Use Barricade Tape, traffic cones and/or traffic flares as rists to stay off of the bridge until such time as the bridge may
[] - Conta	ct: (1) District Maintenance Supervisor (if bridge is State maintained)	
	(2) City or County Highwa	y Maintenance Official (if bridge is not State maintained)
	(3) Tennessee Highway P	atrol and/or local law enforcement Officers as appropriate
	(4) TDOT Regional Bridge	Engineer Engineer
	Bridge should remain closed until the water recedes and a daylight visual inspection is made TDOT bridge inspection team.	

PUBLICATION DATE

HIGHWAY BRIDGE SCOUR PLAN OF ACTION REPORT



	tate District maintenance or local highway maintenance bridge on the selected detour route shall be checked
[] - The bridge can be re-opened only after a TD units and they are determined to be structure.	OT bridge inspection team checks the substructure rally stable.
CONTACT PERSONNEL:	TELEPHONE NUMBER:
COUNTY MAYOR'S OFFICE	(731) 968-0122
HWY. CHIEF ADMINISTRATOR'S OFFICE	(731) 968-9201
COUNTY SHERIFF'S OFFICE	(731) 968-7777
as appropriate, photographs of the bridge ar	the inspection, a brief summary of findings and, and stream channel measurements. If significant be copied to Bridge Inspection Headquarters.
Suggested List of Equipment to conduct the Inspe	ection:
Latest Bridge Inspection Report	
Scour POA Report with the above Checklist	
Bridge Design Plans, if available	
Tape measure with weight	
Plumb bob	
Range Pole	
A 1000 Foot Roll of yellow Polyethylene Barricade	Tape printed with the following message:
SAFETY HAZARD KEI	EP AWAY
A Barricade Tape Dispenser with serrated cutter	

TDOT two-way radio (State Personnel only) and/or cellular telephone TDOT radio directory (State Personnel only)

Traffic Safety Flares - Minimum of four (4) or set of electronic warning flashers

Traffic Cones - Minimum of four (4)

A roll of Duct Tape