CONST. NO. 19005-3161-44		
PROJECT NO.	YEAR	SHEET NO.
BH-I-40-4(86)	2015	

REVISIONS

NO.	DATE	BY	BRIEF DESCRIPTION

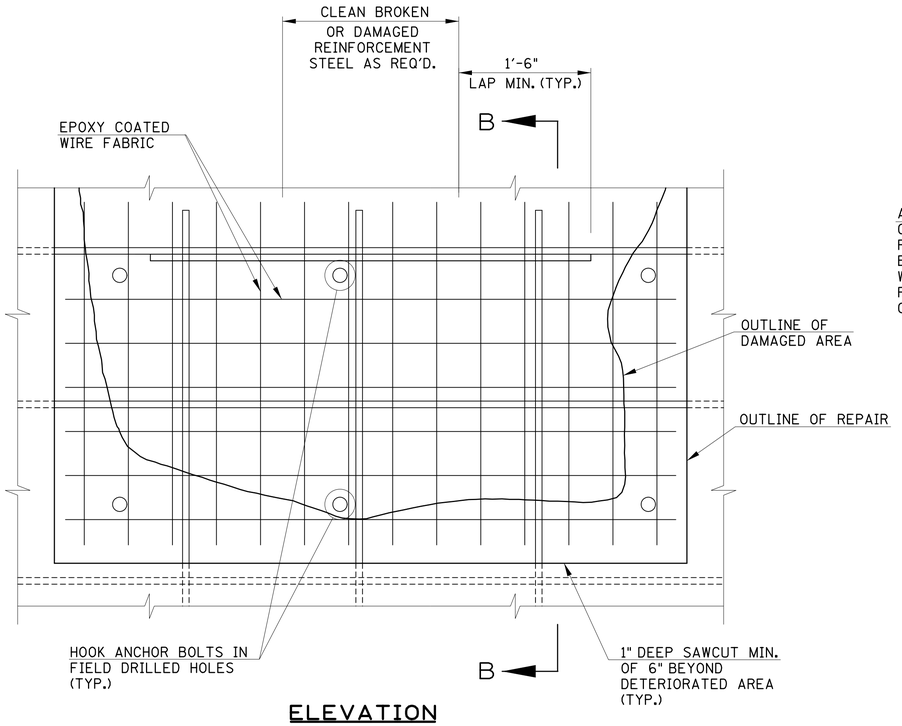

ELEVATION

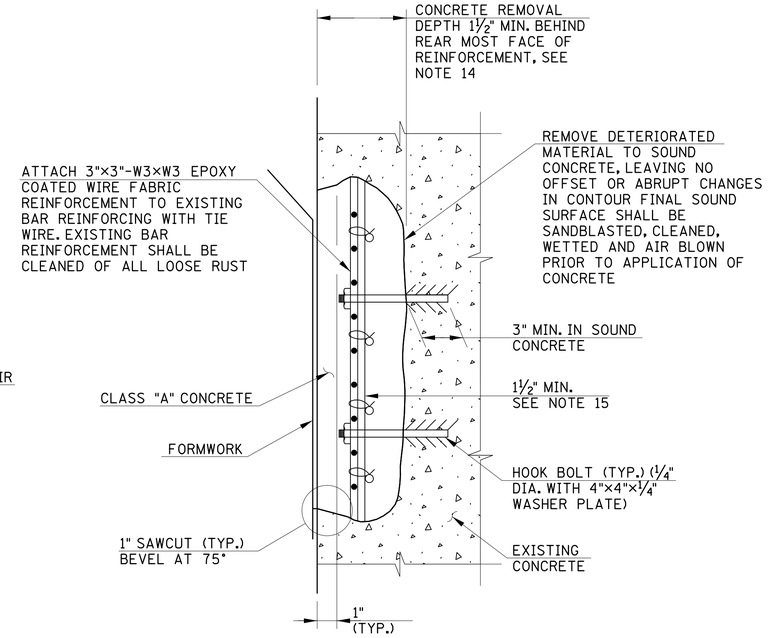

SECTION B-B

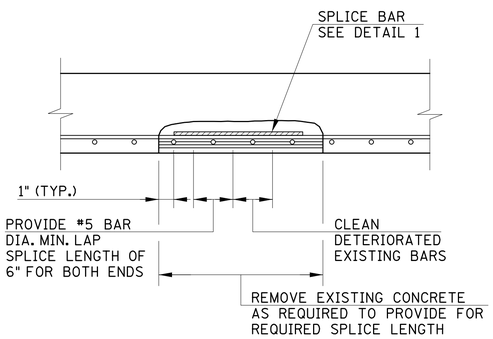

REINFORCEMENT REPAIR

N.T.S.

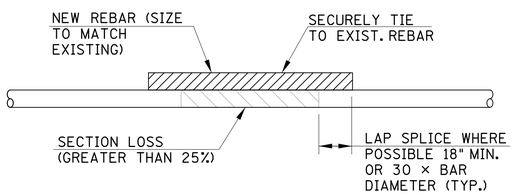

DETAIL I

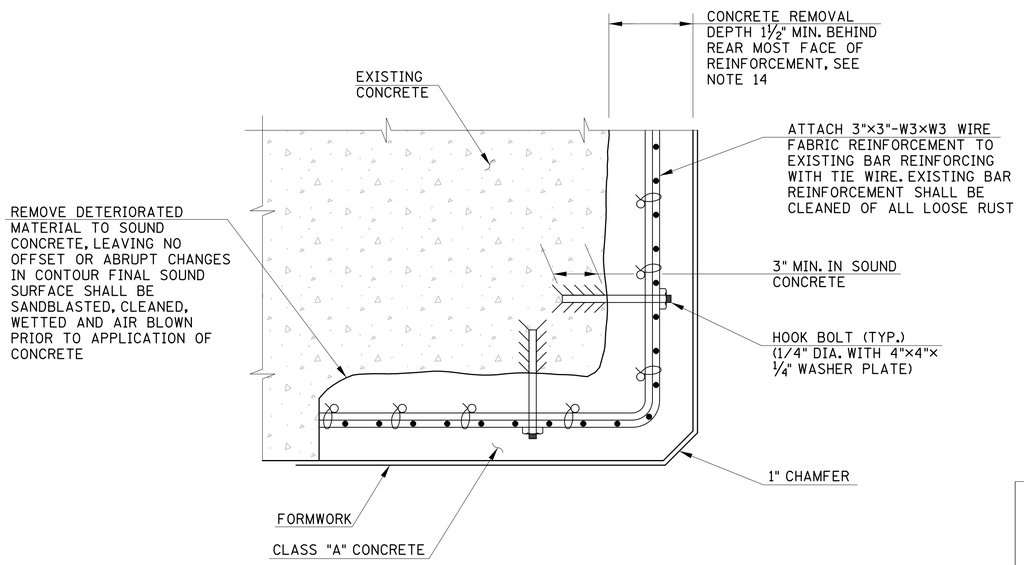

DETAIL AT CORNERS

NOTES:

1. THE CONTRACTOR SHALL VERIFY IN THE FIELD THE EXTENT OF ALL SPALL AND/OR DELAMINATED DAMAGE. ALL SPALLED OR DELAMINATED AREAS NOT INDICATED ON THESE DRAWINGS SHALL BE REPAIRED AS DIRECTED AND APPROVED BY THE ENGINEER.
2. REPAIR DETAILS APPLY TO ALL HOLLOW AREAS AND SPALLS IN EITHER PIERS OR ABUTMENTS.
3. SURFACE PREPARATION, PROPORTION AND MIXING OF MATERIALS, APPLICATION OF MATERIALS, AND REPAIR PROCEDURES SHALL BE IN ACCORDANCE WITH SPECIFICATIONS.
4. NEW CONCRETE PATCHES SHALL MATCH SHAPE OF EXISTING CONCRETE SURFACES.
5. ALL EXPOSED REINFORCEMENT WITHIN REPAIR AREA SHALL BE CLEANED, AND SAND BLASTED. BROKEN PORTION OF REBARS SHALL BE REMOVED AND LAP SPLICED WITH NEW REBARS.
6. IF CORRODED REINFORCING BARS HAVE SECTION LOSSES EXCEEDING 25% THE CORRODED BARS SHALL BE REPLACED IN ACCORDANCE WITH THE REINFORCEMENT REPAIR DETAIL SHOWN ON THIS SHEET.
7. ALL CRACKS WHICH ARE ASSOCIATED WITH DELAMINATION SHALL BE CUT OUT TOGETHER WITH THE DELAMINATED CONCRETE.
8. TO THE EXTENT REASONABLE LIMITS OF ALL PATCHES IN ELEVATION SHALL MAINTAIN HORIZONTAL AND VERTICAL LINES.
9. IF REPAIR AREA EXTENDS NEAR EDGE OF MEMBER, DO NOT REMOVE DAMAGED REINFORCEMENT NEAR EDGE WITHIN MINIMUM LAP SPLICE LENGTH.
10. HOOK BOLTS SHALL BE SPACED AT 1'-0" CENTERS FOR REPAIRS LESS THAN 3" THICK AND 1'-6" FOR GREATER DEPTH.
11. IF REPAIR INCLUDES A CORNER OF MEMBER, PROVIDE HOOK BOLTS IN BOTH SURFACES.
12. WHERE NEW REINFORCING BAR HAS BEEN DETERMINED TO BE REQUIRED, BILL OF STEEL IS SHOWN ON THE REPAIR DRAWING. ADDITIONAL BAR NOT INDICATED ON THE DRAWINGS SHALL BE PROVIDED AS ORDERED BY THE ENGINEER.
13. NOTIFY THE ENGINEER IF DEPTH OF DETERIORATED CONCRETE FOUND EXCEEDS THE MINIMUM LIMIT SPECIFIED.
14. FOR AREAS WITH ONLY SURFACE DETERIORATION, THE ENGINEER MAY ELECT TO USE ITEM 604-10.05 WHICH DOES NOT REQUIRE THE REMOVAL OF CONCRETE BEHIND THE EXISTING REBAR.
15. HOOK BOLTS AND WIRE FABRIC SHALL BE INCLUDED IN PRICE BID FOR CONCRETE REPAIRS, ITEM 604-10.54, OR CONCRETE, ITEM 604-10.05 AS DESIGNATED BY THE ENGINEER.

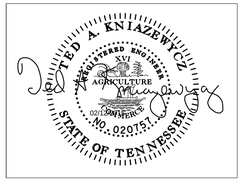

BRIDGE NO. 3

STATE OF TENNESSEE
DEPARTMENT OF TRANSPORTATION

GENERAL REPAIR DETAILS

I-40
OVER
CLINTON STREET
BR. NO. 19-10040-16.75
DAVIDSON COUNTY
2015

BR-119-123

DESIGNED BY GRESHAM SMITH & PARTNERS DATE 2/09/2015
DRAWN BY R. PALMER DATE 1/2015
SUPERVISED BY T. KNIAZEWYCZ DATE 1/2015
CHECKED BY T. KNIAZEWYCZ DATE 2/2015

GRESHAM SMITH AND PARTNERS

kniazet
Q:\2807115\b\Bridge B Clinton\bridge 2\8071b15b2rd.sht
2/13/2015
PRF