



a global professional services company

creative thinking. **custom solutions.**®

---

220 Athens Way, Suite 410 | Nashville, Tennessee 37228 | Telephone 615-255-9300 | Facsimile 615-255-9345 | [www.ensafe.com](http://www.ensafe.com)

August 31, 2012

Mr. Jim Ozment  
Tennessee Department of Transportation  
Dept. Environmental Planning and Permits  
505 Deaderick Street, Suite 900  
Nashville, TN 37243-0334

Re: Asbestos Inspection Report  
Shelby County; SR-14 Overflow Bridge  
Bridge #: 79SR0140039 (LM 27.25)  
TDOT Project # 79024-4298-04, PIN 116134.00  
TDOT Contract: E1647; Work Order: 06

Dear Mr. Ozment:

Enclosed is the asbestos inspection report for the above-referenced bridge. A total of 42 samples were obtained during the inspection. Asbestos was detected in the wrap around the drain pipes that penetrate the decking. There were 27 drains located, but based on the condition of the drains, it was not possible to determine if the entire drain pipe is wrapped in this material or if it is only the portions that extend below the bridge deck. Most likely it is the entire drain.

In its current condition this ACM was determined to be non-friable, that is, it could not be pulverized using hand pressure alone. Accordingly, it is classified under EPA NESHAP rules (40 CFR 61) as a Category II non-friable ACM in its current condition. Depending upon the type of bridge maintenance required, there could be potential for the material to become pulverized and thereby become friable, at that time it would be considered a "Regulated Asbestos-Containing Material" (RACM).

OSHA would consider the abatement of RACM to be a Class II activity, which would require trained workers and a competent person to oversee the work (an asbestos supervisor). Additionally, State of Tennessee asbestos accreditation requirements (TCA 1200-01-20) mandate that such work be performed by an accredited firm (contractor) using accredited abatement workers and supervisors.

If you should have any questions, please call me at 615-255-9300.

Sincerely,

EnSafe Inc.

*Tammy Keim Williams*


By: Tammy Keim Williams  
*Project Manager*

Enclosure



## TENNESSEE DEPARTMENT OF TRANSPORTATION ASBESTOS INSPECTION REPORT

Overflow Bridge  
Bridge No. 79SR0140039 (LM 27.25)  
State Route 14  
Bartlett, Shelby County

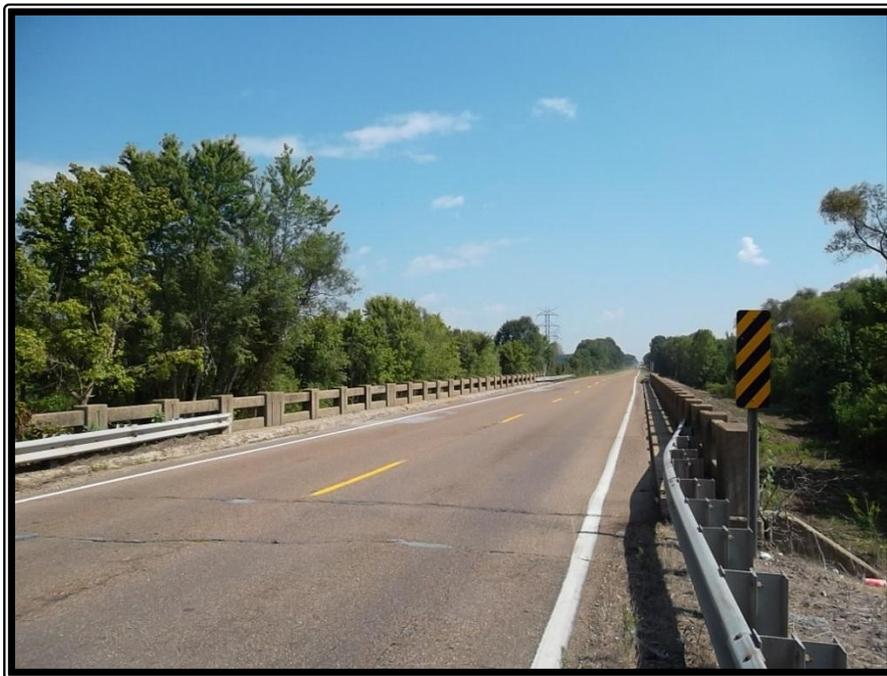

Prepared by:



**ENSAFE INC.**

220 Athens Way, Suite 410  
Nashville, Tennessee 37228

August 31, 2012

EnSafe Project Number: 0888812717

Corey Coleman (Signature)

Tennessee Asbestos Inspector Accreditation No:A-I-48788-18528

---

## TABLE OF CONTENTS

<b>1.0</b>	<b>INTRODUCTION .....</b>	<b>1</b>
1.1	TDOT BRIDGE IDENTIFICATION .....	1
1.2	GENERAL DESCRIPTION .....	1
<b>2.0</b>	<b>INSPECTION .....</b>	<b>1</b>
2.1	PERSONNEL AND DATE(S) OF INSPECTION .....	1
2.2	VISUAL SURVEY .....	2
2.3	ACCESS TO BRIDGE COMPONENTS .....	2
2.3.1	Top of Bridge Deck .....	2
2.3.2	Underside of Bridge Deck .....	2
2.3.3	Bridge Beams.....	2
2.3.4	Bridge Piers/Bents and Supports.....	2
2.3.5	Side Rails .....	2
2.3.6	Abutments .....	3
2.3.7	Bridge Drainage .....	3
<b>3.0</b>	<b>ANALYTICAL PROCEDURES.....</b>	<b>3</b>
3.1	ASBESTOS ANALYSIS PROCEDURES.....	3
3.2	LABORATORY NAME AND ACCREDITATION .....	3
<b>4.0</b>	<b>REGULATORY OVERVIEW.....</b>	<b>4</b>
4.1	NATIONAL EMISSION STANDARDS FOR HAZARDOUS AIR POLLUTANTS.....	4
4.1.1	Definitions.....	4
<b>5.0</b>	<b>RESULTS .....</b>	<b>5</b>
5.1	RESULTS OF ASBESTOS BULK SAMPLE ANALYSIS.....	5
<b>6.0</b>	<b>QUALIFICATIONS .....</b>	<b>5</b>
 <b>TABLES</b>		
Table – 1: Analytical Laboratory.....		3
Table – 2: Materials Containing Greater than 1% Asbestos .....		5
 <b>FIGURES</b>		
Figure – 1: Site Vicinity Map .....		6
Figure – 2: Asbestos-Containing Pipe Wrap Sample Locations.....		8
 <b>APPENDICES</b>		
Appendix A: Asbestos Inspection Accreditations .....		10
Appendix B: Photographs .....		14
Appendix C: Asbestos Sample Laboratory Analysis Data.....		16

## 1.0 INTRODUCTION

This report presents the findings of an inspection for asbestos containing materials (ACM) completed on the bridge identified in Section 1.1. The inspection was completed by EnSafe Inc. in accordance with the State of Tennessee, Department of Transportation Environmental Division, Social and Cultural Resources Office, Hazardous Materials Section requirements.

### 1.1 TDOT BRIDGE IDENTIFICATION

The bridge is identified in the TDOT Project System/Bridge Management System as:

TDOT PE Number: 79024-4298-04  
TDOT PIN Number: 116134.00  
Bridge Inventory Number: 79SR0140039  
State Route (SR) Number: SR-14  
Log Mile (LM) Number: 27.25

### 1.2 GENERAL DESCRIPTION

The bridge, located on SR-14 at LM 27.25, is a 7-span 200-foot overflow bridge, in Bartlett, Shelby County, Tennessee. Figure – 1 shows the general location of the bridge.

## 2.0 INSPECTION

The identification of ACM is performed by collecting bulk samples of suspect materials and having those samples analyzed by a laboratory. ACM are those materials found to contain greater than 1% asbestos by calibrated visual area estimation by Polarized Light Microscopy (PLM).

Bulk sampling is a procedure in which representative homogeneous sampling areas in a structure are identified and then sampled. A homogeneous sampling area is defined as an area that contains material of the same type (uniform in color and texture) and is applied during the same general time period. Once the homogeneous sampling areas are identified, bulk samples of suspect materials are obtained at the discretion of our inspectors, based on site conditions and past experience.

### 2.1 PERSONNEL AND DATE(S) OF INSPECTION

The sampling and field activities were performed on August 27, 2012, by Corey Coleman and Robert Bailey, Accredited State of Tennessee Asbestos Inspectors. A copy of the inspectors' and EnSafe's current accreditation from the State of Tennessee is included in Appendix A.

## **2.2 VISUAL SURVEY**

EnSafe's survey began with a walk-through and visual survey of the structures located on the property. The visual survey consisted of:

- sketching the structure and/or verifying the plans provided
- locating and identifying homogeneous areas (HAs) of suspect materials that may contain asbestos minerals
- determining applicable sampling locations

## **2.3 ACCESS TO BRIDGE COMPONENTS**

Individual bridge components were accessed by the following methods:

### **2.3.1 Top of Bridge Deck**

The bridge deck was covered with asphalt and therefore not sampled. Traffic control was not required for the inspection of the top of the bridge deck. Samples (labeled as 39HA-8A through 39HA-8C) of the concrete sidewalk were obtained using hammers and chisels. The caulking from the sidewalk (labeled as 39HA-14A through 39HA-14C) was also sampled.

### **2.3.2 Underside of Bridge Deck**

The underside of the bridge deck was accessed by foot and samples obtained either on foot or by use of a ladder. Samples were obtained using hammers and chisels. Samples 39HA-4A through 39HA-4C were obtained from the underside of the bridge deck.

### **2.3.3 Bridge Beams**

The bridge beams were accessed by foot. Beam samples were obtained using hammers and chisels (39HA-3A through 39HA-3C). Samples obtained from the felt between the bent caps and the beams are labeled 39HA-13A through 39HA-13C.

### **2.3.4 Bridge Piers/Bents and Supports**

The bridge piers and bents were accessed on foot and using ladders. The bridge support components consisted of support columns and caps. Samples 39HA-6A through 39HA-6C were obtained from the support columns of the bridge. Samples 39HA-5A through 39HA-5C were obtained from the bent caps. Samples 39HA-7A through 39HA-7C were obtained from the diaphragms above the bent caps.

### **2.3.5 Side Rails**

There were concrete side rails extending the length of both sides of the bridge. Both were accessible on foot using ladders. Three samples were obtained of the side rails (39HA-9A through 39HA-9C) and of the rail posts (39HA-10A through 39HA-10C) by using hammers and chisels.

### 2.3.6 Abutments

The abutments on both sides of the bridge were accessed on foot. The abutment appeared to consist of a back wall, wing wall, and footer. Samples were obtained using hammers and chisels. Samples 39HA-1A through 39HA-1C were obtained from the footers. Samples 39HA-2A through 39HA-2C were obtained from the back walls. Samples 39HA-11A through 39HA-11C were obtained from the abutment wing walls.

### 2.3.7 Bridge Drainage

Drainage from the bridge is through piping cored through the bridge deck on the northwest side of the bridge. The piping appeared to be metal and was coated with a hard wrapping. The pipe wrap was sampled as 39HA-12A through 39HA-12C.

## 3.0 ANALYTICAL PROCEDURES

### 3.1 ASBESTOS ANALYSIS PROCEDURES

The bulk samples are analyzed in the laboratory using PLM coupled with dispersion staining. PLM is an analytical method for asbestos identification, which identifies the specific asbestos minerals by their unique optical properties. The optical properties are a result of the mineral's chemical composition, physical atomic structure, and visual morphology. This is the U.S. Environmental Protection Agency (EPA) recommended method of analysis for asbestos identification in bulk samples.

In most instances, samples from each HA are analyzed on a "first positive stop" basis. "First positive stop" means that if one sample from a HA of material is found to contain greater than 1% asbestos, the remaining samples from that HA are not analyzed and the material is assumed to contain asbestos. In addition, samples which contain multiple layers, or that have associated mastic or adhesive backing, are analyzed as two or more separate samples. Samples that are identified to contain 1% or less asbestos minerals have been point counted by the laboratory for confirmation.

### 3.2 LABORATORY NAME AND ACCREDITATION

The bulk samples collected for this inspection were analyzed by a laboratory that has received accreditation from the National Institute of Standards and Technology (NIST) under the National Voluntary Laboratory Accreditation Program (NVLAP). The name and accreditation number of the analytical laboratory that analyzed the samples for this inspection is indicated in Table - 1:

**Table – 1: Analytical Laboratory**

<b>Laboratory</b>	Scientific Analytical Institute
<b>NVLAP Number</b>	200664-0

## 4.0 REGULATORY OVERVIEW

### 4.1 NATIONAL EMISSION STANDARDS FOR HAZARDOUS AIR POLLUTANTS

The EPA's National Emission Standards for Hazardous Air Pollutants (NESHAP) regulations (40 CFR 61, Subpart B) requires that all regulated asbestos-containing materials (RACM) be properly removed prior to any renovation or demolition activities that will disturb them. These regulations define RACM as:

- Friable ACM.
- Category I non-friable ACM that has become friable.
- Category I non-friable ACM that will be or has been subject to sanding, grinding, cutting, or abrading.
- Category II non-friable ACM that has a high probability of becoming, or has become crumbled, pulverized, or reduced to powder by the forces expected to act on the material in the course of demolition or renovation operations.

#### 4.1.1 Definitions

Significant definitions related to regulation of asbestos under NESHAPS include:

**Friable asbestos-containing material (ACM)**, is defined by the Asbestos NESHAP, as any material containing more than one percent (1%) asbestos as determined using the method specified in Appendix A, Subpart F, 40 CFR Part 763, Section 1, Polarized Light Microscopy (PLM), that, when dry, can be crumbled, pulverized or reduced to powder by hand pressure. (Sec. 61.141)

**Non-friable ACM** is any material containing more than one percent (1%) asbestos as determined using the method specified in Appendix A, Subpart F, 40 CFR Part 763, Section 1, Polarized Light Microscopy (PLM), that, when dry, cannot be crumbled, pulverized, or reduced to powder by hand pressure. EPA also defines two categories of non-friable ACM, Category I and Category II non-friable ACM, which are described as follows:

**Category I non-friable ACM** is any asbestos-containing packing, gasket, resilient floor covering or asphalt roofing product which contains more than one percent (1%) asbestos as determined using polarized light microscopy (PLM) according to the method specified in Appendix A, Subpart F, 40 CFR Part 763. (Sec. 61.141)

**Category II non-friable ACM** is any material, excluding Category I non-friable ACM, containing more than one percent (1%) asbestos as determined using polarized light microscopy according to the methods specified in Appendix A, Subpart F, 40 CFR Part 763 that, when dry, cannot be crumbled, pulverized, or reduced to powder by hand pressure. (Sec. 61.141)

**"Regulated Asbestos-Containing Material" (RACM)** is (a) friable asbestos material, (b) Category I non-friable ACM that has become friable, (c) Category I non-friable ACM that will be or has been subjected to sanding, grinding, cutting or abrading, or (d) Category II non-friable ACM that has a high probability of becoming or has become crumbled, pulverized, or reduced to powder by the forces expected to act on the material in the course of demolition or renovation operations.

**Friable materials** are defined as those which can be crumbled, pulverized, or reduced to powder by hand pressure when dry. The NESHAP regulations also establish specific notification and control requirements for renovation and demolition work.

## 5.0 RESULTS

The results of the asbestos inspection are presented in the following sections.

### 5.1 RESULTS OF ASBESTOS BULK SAMPLE ANALYSIS

A total of 42 samples were obtained from the bridge. Multiple samples of each HA were collected in accordance with State of Tennessee, Department of Transportation Environmental Division, Social and Cultural Resources Office, Hazardous Materials Section requirements and delivered to the laboratory for visual observation and microscopic analysis. The samples were selected based on HAs of suspect materials, as described in Section 2.2.

Table – 2 below summarizes the various sampled materials which were found to contain greater than 1% asbestos minerals. Figure – 2 delineates the locations of ACM-containing samples. Photographs of the different HAs sampled that were found to be asbestos-containing are presented in Appendix B, and the analytical result of all the samples collected from the property, along with the chain-of-custody records, are included in Appendix C.

**Table – 2: Materials Containing Greater than 1% Asbestos**

Sample No.	HA/Material Description	Location (Bridge Component)	Approx Qty.	Friable (Y/N)	Type Asbestos and Content
1213990PLM_34-39HA-12A	HA-12 Pipe Wrap	Drainage Pipes	27 LF	N	20% Chrysotile
1213990PLM_39-39HA-12B *	HA-12 Pipe Wrap	Drainage Pipes	27 LF	N	assumed 20% Chrysotile -not analyzed
1213990PLM_36-39HA-12C *	HA-12 Pipe Wrap	Drainage Pipes	27 LF	N	assumed 20% Chrysotile -not analyzed

\* Sample not analyzed. Assumed to be asbestos-containing using “First Positive Stop” method.

HA Homogeneous Area

LF Linear Feet

SF Square Feet

CF Cubic Feet

## 6.0 QUALIFICATIONS

The information presented herein is based on information obtained during the site visit(s) and from previous experience. If additional information becomes available which might impact our conclusions or recommendations, EnSafe requests the opportunity to review the information, reassess the potential concerns, and modify opinions, if warranted.

This report has been prepared on behalf of the Tennessee Department of Transportation. This document is not a Bid Document or a Contract Document. Use of this report or reliance upon information contained in this report by any other party implies an agreement by that party to the same terms and conditions under which service was provided. Furthermore, any party, other than our Client, relying on this document is cautioned that all conclusions made or decisions arrived at based on their review of this document are those solely of the third party, without warranty, guarantee or promise by the author. These findings are relevant to the dates of our services and should not be relied upon to represent conditions at substantially earlier or later dates.

## Figure – 1: Site Vicinity Map

SHELBY COUNTY



**79-SR014-2725**  
**Federal ID: 79SR0140039**  
 Road Name:  
 Crossing: OVERFLOW  
 OVR/UND PASS:  
 Road Name 2:


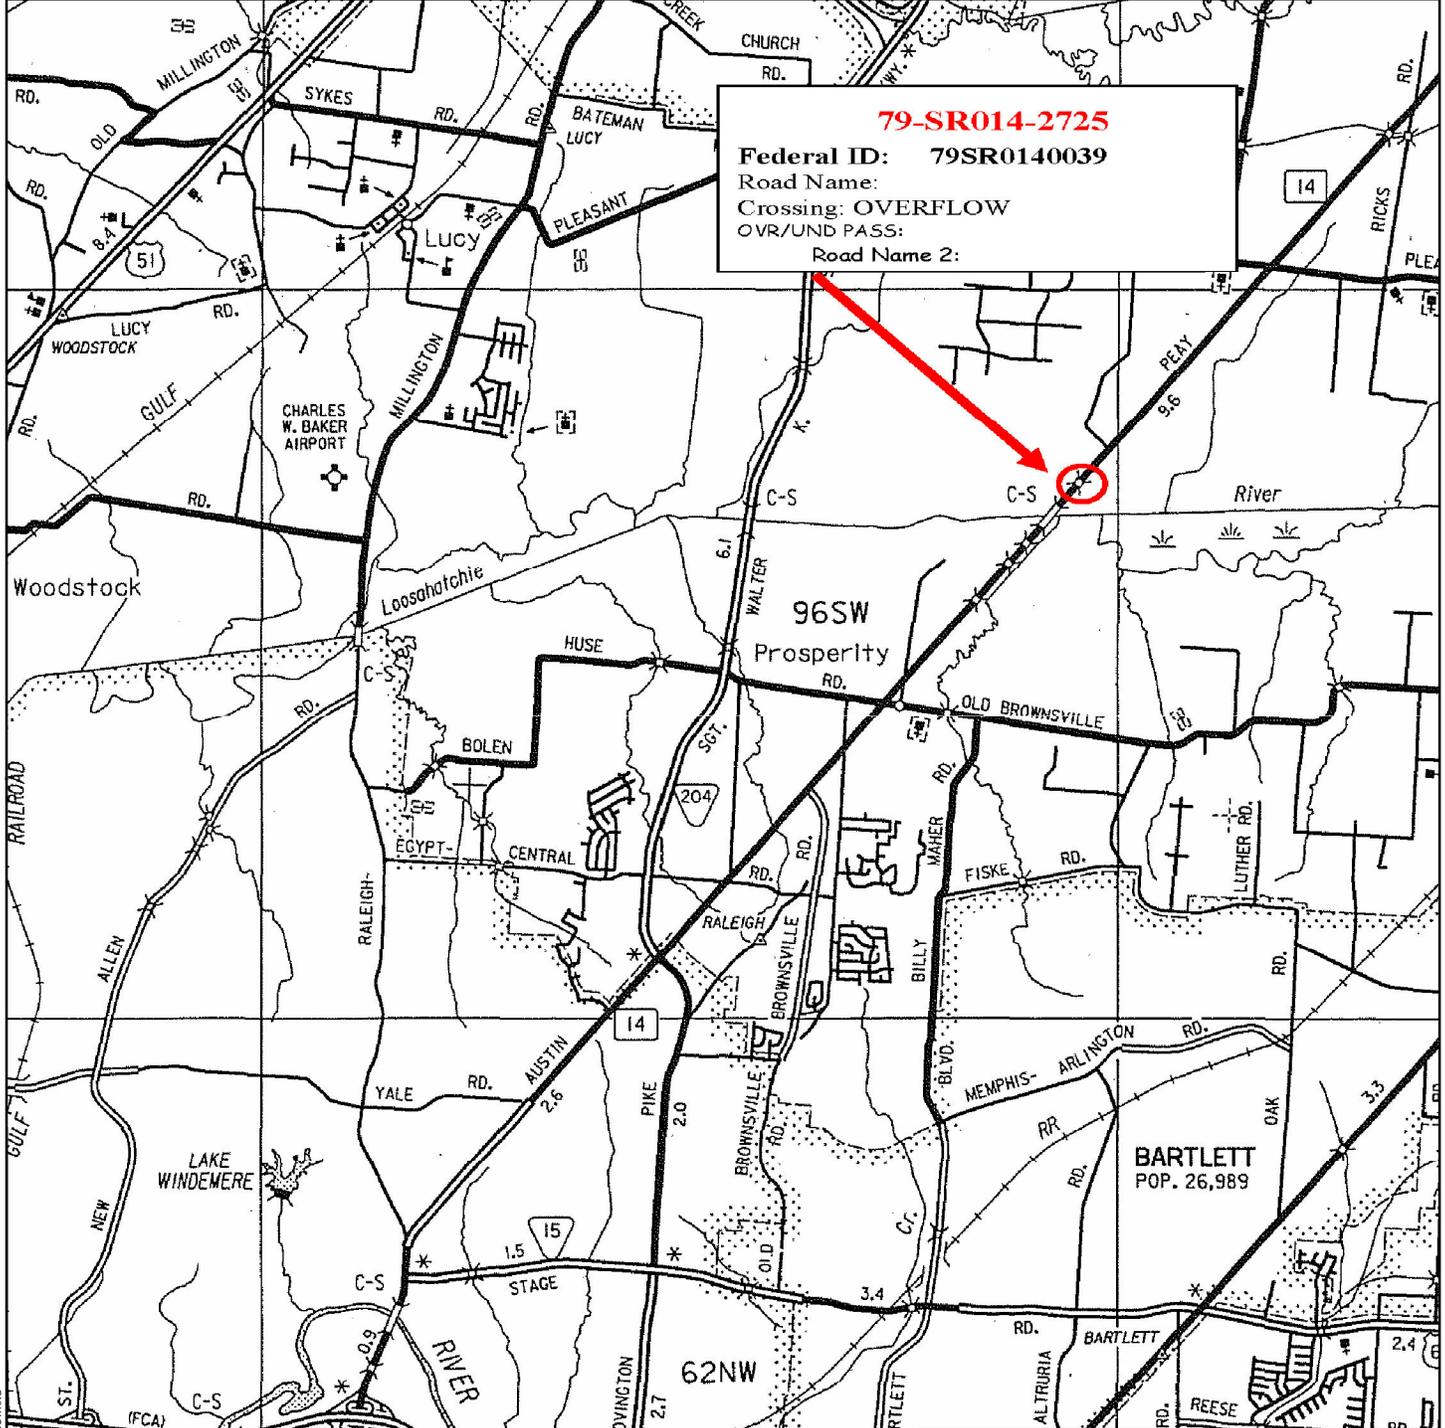


Figure 1  
 Site Vicinity Map  
 Bridge 79SR0140039  
 TDOT PE 79024-4298-04, PIN 116134.00  
 Shelby County, Tennessee




Source: Obtained from TDOT Bridge Inspection Reports; Used with permission from TDOT

REQUESTED BY: T. Keim  
 DRAWN BY: N. Rinehart  
 DATE: 8/14/2012  
 PROJECT NO: 0888812717



X:\TDOT\Bridge Sampling\SiteLocation\_79SR0140039.mxd

## **Figure – 2: Asbestos-Containing Pipe Wrap Sample Locations**

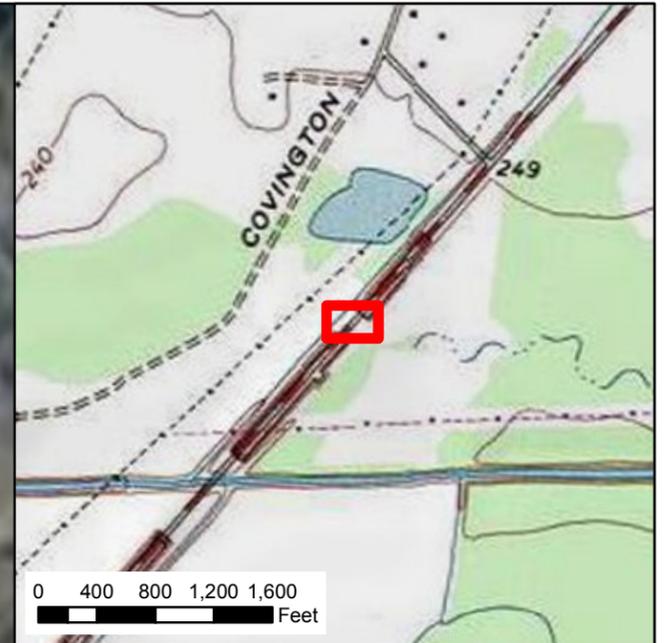


- 39HA-12A
- 39HA-12B
- 39HA-12C

X:\TDOT\Bridges\Sampling\SiteMap\_79SR0140039.mxd

### Legend

- Sampled Drain Pipe Wrap Location. Approximately twenty seven 4-inch diameter drains total, with an estimated 27 linear feet of ACM for all 27 drains.



**Figure 2**  
**Asbestos-Containing Pipe Wrap**  
**Sample Locations**  
**Bridge 79SR0140039**  
**TDOT PE 79024-4298-04, PIN 116134.00**  
**Shelby County, Tennessee**

Requested By: T. Keim
Drawn By: N. Rinehart
Date: 8/30/2012
Project: 0888812717



1-800-588-7962  
 WWW.ENSAFE.COM

## **APPENDIX A: ASBESTOS INSPECTION ACCREDITATIONS**



## THE STATE OF TENNESSEE

Department of Environment and Conservation

Solid & Hazardous Waste Management

Toxic Substances Program

401 Church Street 5th Floor L&C Tower Nashville TN 37243

By virtue of the authority vested in me, I hereby accredit:

### EnSafe

5724 Summer Trees Dr. Memphis TN, 38134

to conduct **ASBESTOS ACTIVITIES** in schools or public and commercial buildings in Tennessee. This firm is responsible for compliance with the applicable requirements of Rule 1200-01-20.

Discipline	Type	Accreditation Number	Effective Date	Expiration Date
Accreditation	Re-Accreditation	A-F-214-13112	August 01, 2011	August 31, 2012

Given under my hand and the Seal of the State of Tennessee in Nashville,

This 7th Day of September 2011

Mike Appie, Director  
Division of Solid Waste Management



CN-1324

RDA-1320

**THE STATE OF TENNESSEE**  
Department of Environment and Conservation Toxic Substances Program



**Corey A. Coleman**

DOB	Sex	HGT	WGT
30-Nov-1976	M	5' 11"	250

Discipline	Accreditation	Expiration
Inspector	A-148788-18528	Jan-31-2013

*Individual*

*Re-Accreditation*

Date Issued: 3/27/2012

**Asbestos Accreditation**

**THE STATE OF TENNESSEE**  
Department of Environment and Conservation Toxic Substances Program



**Robert R Bailey**

DOB	Sex	HGT	WGT
22-Jun-1981	M	5' 10"	155

<b>Discipline</b>	<b>Accreditation</b>	<b>Expiration</b>
Inspector	A-I-72565-20354	Mar-31-2013

*Individual*    *Initial*

Date Issued: 3/23/2012

**Asbestos Accreditation**

## **APPENDIX B: PHOTOGRAPHS**



Photo 1: Bridge Identification photograph.



Photo 2: Asbestos-containing sample of wrapping located around the drain pipes.

## **APPENDIX C: ASBESTOS SAMPLE LABORATORY ANALYSIS DATA**



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
EPA Method: 600/R-93/116 and 600/M4-82-020



**Customer:** EnSafe, Inc.  
308 N. Peters Rd. Ste. 200  
Knoxville, TN 37922

**Attn:** Tammy Keim

**Lab Order ID:** 1214125

**Analysis ID:** 1214125PLM

**Date Received:** 8/28/2012

**Date Reported:** 8/28/2012

**Project:** TDOT Shelby County Hwy 14 Bridge 39

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
39HA1A	Concrete from abutment	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_1					Crushed
39HA1B	Concrete from abutment	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_2					Crushed
39HA1C	Concrete from abutment	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_3					Crushed
39HA2A	Concrete from abutment wall	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_4					Crushed
39HA2B	Concrete from abutment wall	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_5					Crushed
39HA2C	Concrete from abutment wall	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_6					Crushed
39HA3A	Concrete from bridge beams	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_7					Crushed
39HA3B	Concrete from bridge beams	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_8					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Estimated MDL is 0.1%.

Bobby Wheatley (42)

Analyst

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Nathaniel Durham, MS or Approved Signatory



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
EPA Method: 600/R-93/116 and 600/M4-82-020



**Customer:** EnSafe, Inc.  
308 N. Peters Rd. Ste. 200  
Knoxville, TN 37922

**Attn:** Tammy Keim

**Lab Order ID:** 1214125

**Analysis ID:** 1214125PLM

**Date Received:** 8/28/2012

**Date Reported:** 8/28/2012

**Project:** TDOT Shelby County Hwy 14 Bridge 39

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
39HA3C	Concrete from bridge beams	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_9					Crushed
39HA4A	Concrete from bridge deck	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_10					Crushed
39HA4B	Concrete from bridge deck	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_11					Crushed
39HA4C	Concrete from bridge deck	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_12					Crushed
39HA5A	Concrete from bent cap	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_13					Crushed
39HA5B	Concrete from bent cap	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_14					Crushed
39HA5C	Concrete from bent cap	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_15					Crushed
39HA6A	Concrete from bent columns	None Detected		100% Other	Gray Non Fibrous Heterogeneous
1214125PLM_16					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Estimated MDL is 0.1%.

Bobby Wheatley (42)

Analyst

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Nathaniel Durham, MS or Approved Signatory



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
EPA Method: 600/R-93/116 and 600/M4-82-020



**Customer:** EnSafe, Inc.  
308 N. Peters Rd. Ste. 200  
Knoxville, TN 37922

**Attn:** Tammy Keim

**Lab Order ID:** 1214125

**Analysis ID:** 1214125PLM

**Date Received:** 8/28/2012

**Date Reported:** 8/28/2012

**Project:** TDOT Shelby County Hwy 14 Bridge 39

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
39HA6B	Concrete from bent columns	None Detected		100% Other	Gray Non Fibrous Heterogeneous
1214125PLM_17					Crushed
39HA6C	Concrete from bent columns	None Detected		100% Other	Gray Non Fibrous Heterogeneous
1214125PLM_18					Crushed
39HA7A	Concrete from diaphragm above bent cap	None Detected		100% Other	Gray Non Fibrous Heterogeneous
1214125PLM_19					Crushed
39HA7B	Concrete from diaphragm above bent cap	None Detected		100% Other	Gray Non Fibrous Heterogeneous
1214125PLM_20					Crushed
39HA7C	Concrete from diaphragm above bent cap	None Detected		100% Other	Gray Non Fibrous Heterogeneous
1214125PLM_21					Crushed
39HA8A	Concrete from sidewalk	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_22					Crushed
39HA8B	Concrete from sidewalk	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_23					Crushed
39HA8C	Concrete from sidewalk	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_24					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Estimated MDL is 0.1%.

Bobby Wheatley (42)

Analyst

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Nathaniel Durham, MS or Approved Signatory



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
EPA Method: 600/R-93/116 and 600/M4-82-020



**Customer:** EnSafe, Inc.  
308 N. Peters Rd. Ste. 200  
Knoxville, TN 37922

**Attn:** Tammy Keim

**Lab Order ID:** 1214125

**Analysis ID:** 1214125PLM

**Date Received:** 8/28/2012

**Date Reported:** 8/28/2012

**Project:** TDOT Shelby County Hwy 14 Bridge 39

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
39HA9A	Concrete from rails	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_25					Crushed
39HA9B	Concrete from rails	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_26					Crushed
39HA9C	Concrete from rails	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_27					Crushed
39HA10A	Concrete from rail posts	None Detected		100% Other	Gray, Gray Non Fibrous Heterogeneous
1214125PLM_28					Crushed
39HA10B	Concrete from rail posts	None Detected		100% Other	Gray Non Fibrous Heterogeneous
1214125PLM_29					Crushed
39HA10C	Concrete from rail posts	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_30					Crushed
39HA11A	Concrete from abutment wings	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_31					Crushed
39HA11B	Concrete from abutment wings	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_32					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Estimated MDL is 0.1%.

Bobby Wheatley (42)

Analyst

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Nathaniel Durham, MS or Approved Signatory



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
EPA Method: 600/R-93/116 and 600/M4-82-020



**Customer:** EnSafe, Inc.  
308 N. Peters Rd. Ste. 200  
Knoxville, TN 37922

**Attn:** Tammy Keim

**Lab Order ID:** 1214125

**Analysis ID:** 1214125PLM

**Date Received:** 8/28/2012

**Date Reported:** 8/28/2012

**Project:** TDOT Shelby County Hwy 14 Bridge 39

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
39HA11C	Concrete from abutment wings	None Detected		100% Other	Tan Non Fibrous Heterogeneous
1214125PLM_33					Crushed
39HA12A	Wrap on drain pipes	20% Chrysotile		80% Other	Gray Fibrous Heterogeneous
1214125PLM_34					Teased
39HA12B	Wrap on drain pipes	Not Analyzed			
1214125PLM_35					
39HA12C	Wrap on drain pipes	Not Analyzed			
1214125PLM_36					
39HA13A	Felf between beam and bent cap	None Detected		100% Other	Brown Non Fibrous Heterogeneous
1214125PLM_37					Crushed
39HA13B	Felf between beam and bent cap	None Detected		100% Other	Brown Non Fibrous Heterogeneous
1214125PLM_38					Crushed
39HA13C	Felf between beam and bent cap	None Detected		100% Other	Brown Non Fibrous Heterogeneous
1214125PLM_39					Crushed
39HA14A	Caulk from sidewalk	None Detected		100% Other	Gray Non Fibrous Homogeneous
1214125PLM_40					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommended that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Estimated MDL is 0.1%.

Bobby Wheatley (42)

Analyst

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Nathaniel Durham, MS or Approved Signatory



# Bulk Asbestos Analysis

By Polarized Light Microscopy  
EPA Method: 600/R-93/116 and 600/M4-82-020



**Customer:** EnSafe, Inc.  
308 N. Peters Rd. Ste. 200  
Knoxville, TN 37922

**Attn:** Tammy Keim

**Lab Order ID:** 1214125

**Analysis ID:** 1214125PLM

**Date Received:** 8/28/2012

**Project:** TDOT Shelby County Hwy 14 Bridge 39

**Date Reported:** 8/28/2012

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
39HA14B	Caulk from sidewalk	None Detected		100% Other	Gray Non Fibrous Homogeneous
1214125PLM_41					Ashed
39HA14C	Caulk from sidewalk	None Detected		100% Other	Gray Non Fibrous Homogeneous
1214125PLM_42					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Estimated MDL is 0.1%.

Bobby Wheatley (42)

Analyst

Nathaniel Durham, MS or Approved Signatory



