| TYPE | YEAR | PROJECT NO. | SHEET NO. |
|---|---|---|---|
| RESURF. | 2014 | NH-I-65-3(121) | 3A |
| | | | |
| | | | |
| | | | |

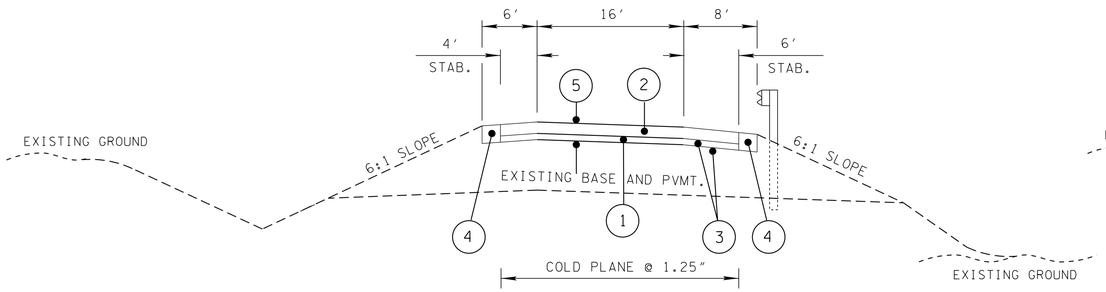


TYPICAL SECTION
ASPHALT OVERLAID CONCRETE RAMPS

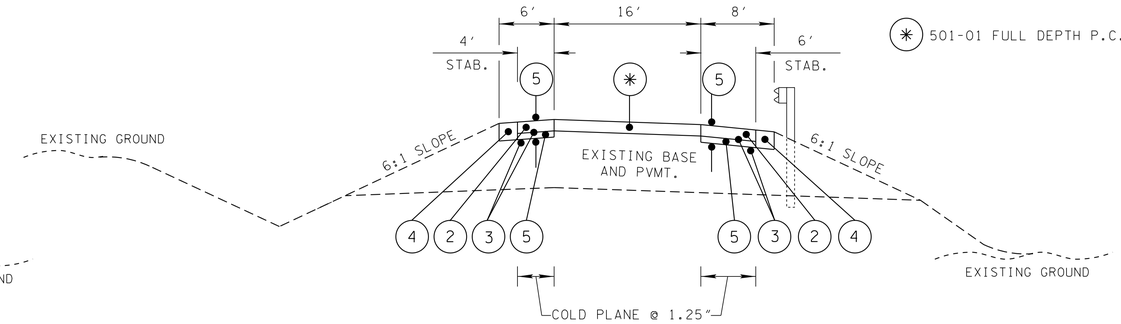


✳ 501-01 FULL DEPTH P.C.C. PAVEMENT REPAIR (SY)

TYPICAL SECTION
CONCRETE RAMPS

## PROPOSED PAVEMENT SCHEDULE

| | |
|---|---|
| (1) SURFACE @ (65 LB/S.Y.)<br>307-03.10 ASPHALT CONC MIX (PG76-22)(BPMB-HM) GR CS | (3) TACK COAT<br>403-01 BITUMINOUS MATERIAL FOR TACK COAT (TC) |
| (2) SURFACE @ 1.25" THICK (110.0 LB/S.Y.)<br>411-03.15 ASPHALT CEMENT (PG76-22) FOR OGFC MIX<br>411-03.16 AGGREGATE FOR OGFC MIX | (4) MINERAL AGGREGATE @ 0.00"<br>303-01 MINERAL AGGREGATE, TYPE A BASE, GRADING D |
| | (5) COLD PLANING @ 1.25" THICK<br>415-01.01 COLD PLANING BITUMINOUS PAVEMENT (TON) |

## BRIDGE NOTES

| LOCATION | LENGTH (FT.) | COLD PLANE DEPTHS | RECOMMENDATION |
|---|---|---|---|
| L.M. 21.43 NB | 156' | 5.50" | COLD PLANE, DECK REPAIR & SEALANT |
| L.M. 21.43 SB | 156' | 6.00" | COLD PLANE, DECK REPAIR & SEALANT |
| L.M. 21.58 NB | 133' | 5.75" | COLD PLANE, DECK REPAIR & SEALANT |
| L.M. 21.58 SB | 133" | 5.00" | COLD PLANE, DECK REPAIR & SEALANT |
| L.M. 22.15 NB | 279' | 5.00" | COLD PLANE, DECK REPAIR & SEALANT |
| L.M. 22.15 SB | 279' | 4.75" | COLD PLANE, DECK REPAIR & SEALANT |

**SPECIAL NOTE**

THE CONTRACTOR SHOULD TAKE EXTREME CARE WHEN COLD PLANING THE EXISTING ASPHALT OFF BRIDGE DECK, SO AS NOT TO DAMAGE THE EXISTING DECK, SEALANT AND/OR EXPANSION JOINT MEMBERS (STEEL PLATES, BARS, AND/OR HEADERS).
IF DAMAGE DOES OCCUR, THE CONTRACTOR SHALL BE RESPONSIBLE FOR NECESSARY REPAIRS ON ALL DAMAGED MEMBERS TO THE SATISFACTION OF OF THE PROJECT ENGINEER AT NO ADDITIONAL COST.

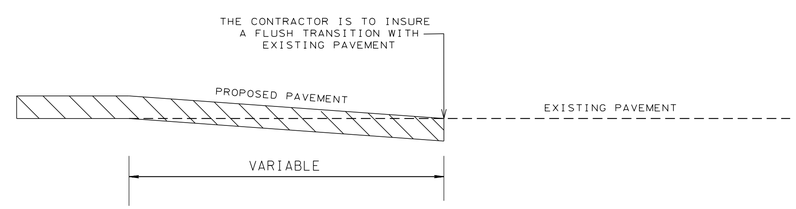


PAVEMENT DETAIL

SEALED BY

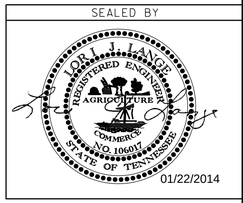


STATE OF TENNESSEE
DEPARTMENT OF TRANSPORTATION

TYPICAL SECTIONS AND TABULATION

22-JAN-2014 13:32
\\JJ03WF01.tdot.state.tn.us\03Shared\SURVEY\DESIGN\Resurfacing Plans\2014Interstate\DavidsonSumnerCos.I-65\104520.01-003ATypicalSections.dgn