TENNESSEE D.O.T.
DESIGN DIVISION
FILE NO.

PIN# 047453.01

TYPE	YEAR	PROJECT NO.	SHEET NO.
RESURF		01011-8158-44	B2
		NH-I-75-3(173)	
BRIDGE REPAIR		01011-4158-04	

TABULATION OF BRIDGE RELATED WORK AND ESTIMATED QUANTITIES

LOCATION OF BRIDGE AND BRIDGE NUMBER	REFERENCE DRAWINGS TO BE PRINTED WITH CONTRACT DRAWIGS	TYPES OF WORK	617-01 BRIDGE DECK SEALANT SY	604-10.34 CONCRETE OVERLAYED BRIDGE DECK REPAIR (FULL DEPTH) SY	604-10.56 CONCRETE OVERLAYED BRIDGE DECK REPAIR (PARTIAL DEPTH) SY
01-I75-10.57 R/ SR71-0.82 (01I00750031)		BRIDGE DECK REPAIR BRIDGE DECK SEALANT	934	110	180
01-I75-10.57 L/ SR71-0.82 (01I00750032)		BRIDGE DECK REPAIR BRIDGE DECK SEALANT	840	75	160
		TOTAL	1774	185	340

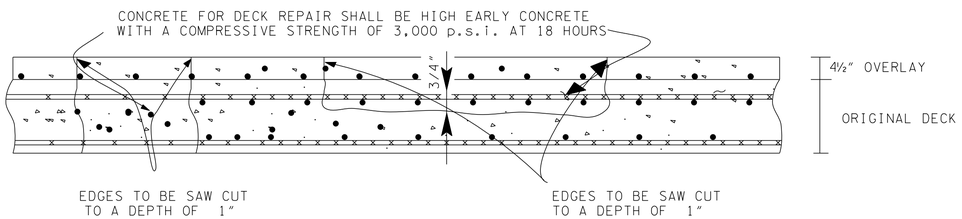

SKETCH SHOWING DECK REPAIR

NOTE: PARTIAL AND FULL DEPTH DECK REPAIR ONLY
REMOVE CONCRETE IN ALL DELAMINATED AREAS TO A DEPTH OF ¾" BELOW THE TOP BAR OF THE TOP MAT OF REINFORCING STEEL IN THE ORIGINAL DECK.

NOTE: PARTIAL AND FULL DEPTH DECK REPAIRS
ALL REINFORCING STEEL IN THE AREAS OF THE DECK REPAIRS SHALL BE COMPLETELY CLEANED. CLEANING SHALL BE DONE PRIOR TO PLACING NEW CONCRETE . AREAS OF CONCRETE REMOVAL SHALL BE DESIGNATED BY PERSONNEL FROM THE HEADQUARTERS, BRIDGE INSPECTION AND REPAIR OFFICE. INSPECTIONS TO DETERMINE AREAS OF DECK REPAIR SHALL BE SCHEDULE WITH THE BRIDGE REPAIR OFFICE AT LEAST (3) DAYS IN ADVANCE.

THE COST OF CONCRETE, CONCRETE REMOVAL, LABOR, CLEANING REBARS AND ANY MISCELLANEOUS MATERIAL REQUIRED SHALL BE PAID FOR UNDER
ITEM NO. 604-10.56 CONCRETE OVERLAYED BRIDGE DECK REPAIR (PARTIAL DEPTH), S.Y. AND
ITEM NO. 604-10.34 CONCRETE OVERLAYED BRIDGE DECK REPAIR (FULL DEPTH) S.Y.

NOTE: ITEM NO. 604-10.56, CONCRETE OVERLAYED DECK REPAIR (PARTIAL DEPTH OF SLAB)
ITEM NO. 604-10.34, CONCRETE OVERLAYED DECK REPAIR (FULL DEPTH OF SLAB)
SHALL BE BID WITH THE CONTINGENCY THAT THIS MAY BE INCREASED, DECREASED OR ELIMINATED AS DIRECTED BY THE ENGINEER.

NOTE: TRAFFIC CONTROL SHALL BE PROVIDED ON ROADWAY UNDERPASS DURING PARTIAL AND FULL DEPTH DECK REPAIR OF OVERHEAD BRIDGE.

NOTE: SEE SHEET B1 FOR NOTES ON BRIDGE DECK REPAIR MATERIAL

NOTE: SEE SHEET B1 FOR NOTES ON POWER DRIVEN HAND TOOLS

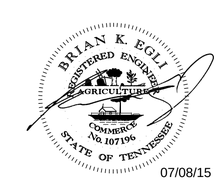

07/08/15

STATE OF TENNESSEE
DEPARTMENT OF TRANSPORTATION

BRIDGE TABULATION AND ESTIMATED QUANTITIES

7/8/2015 11:02:07 AM
P:\STRUCT_RP\Bridgerepair\Sileshi\Tabulated Sheets\Rg.I\INTERSTATE\16 Oct.2015 Letting\Anderson Co\Anderson Co.I75 LM 5.23 to LM 12.12 Tabsheet.dgn